


PERMANENT ABANDONMENT

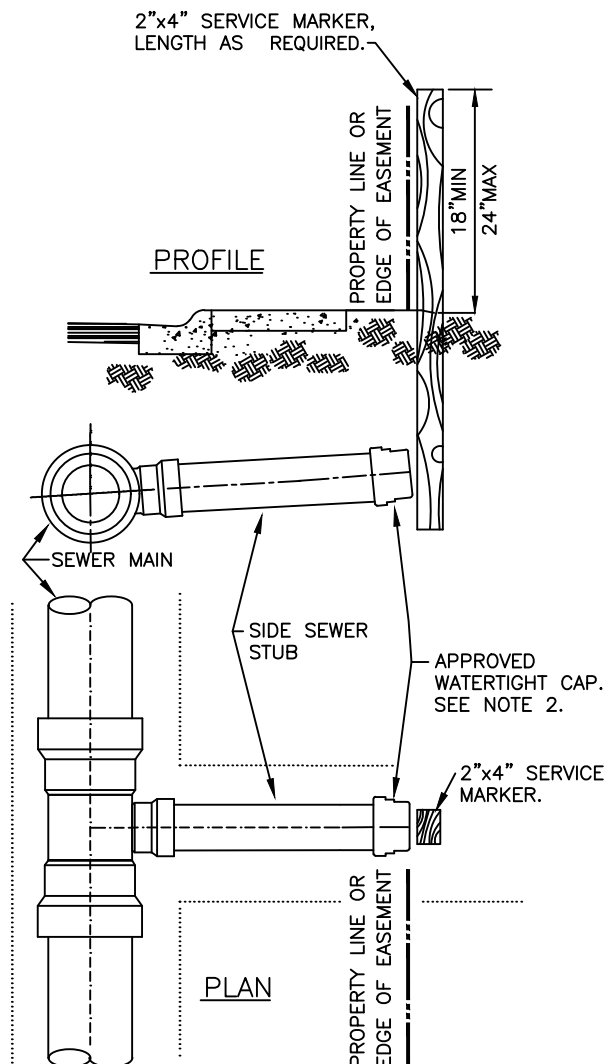

TEMPORARY ABANDONMENT

NOTES:

1. SIDE SEWERS THAT WILL NOT BE REUSED SHALL BE ABANDONED PERMANENTLY AT THE MAIN AND CAPPED WITH AN APPROVED WATERTIGHT, GASKETED CAP. FOR SIDE SEWERS OTHER THAN PVC OR DUCTILE IRON, AN END OF PIPE CHERNE PLUG (#270261 FOR 6", 270270 FOR 8") FOLLOWED BY NON-SHRINK GROUTING AS DIRECTED BY DISTRICT WILL BE REQUIRED.
2. SIDE SEWERS THAT WILL BE REUSED SHALL BE ABANDONED TEMPORARILY WITH AN APPROVED WATERTIGHT, GASKETED CAP AT THE END OF THE 6" STUB AT THE PROPERTY LINE. INSTALL A 2"x4" MARKER AT THE END OF THE STUB.
3. PAINT PORTION OF SERVICE MARKER THAT IS ABOVE GRADE WITH WHITE PAINT. STENCIL "S/S" WITH 3" TALL BLACK LETTERS.

SIDE SEWER CAPPING

NOT TO SCALE

DETAIL APPROVALS

EDITOR TMC

MANAGER CF

NORTHSHORE UTILITY DISTRICT

2025 STANDARD SEWER DETAILS



LAST UPDATED
MAY 2025